



TECH TIPS



Nissan: Bucking Pickup - 1994-96 Nissan Pickup

A stalling or bucking symptom on 1994-96 Nissan Pickup models may be caused by a broken or loose ground wire. These symptoms may occur when accelerating from a stop, or when hitting a bump while at cruising speed.

Check the black ground wire at the harness connector for the air flow meter. Repair the wire if it is broken, then reroute the harness to give it more slack. The engine moves around quite a bit during acceleration, so there needs to be enough slack in the harness to accommodate this movement. This condition will not set a Check Engine code.

*Tom Wayman
Southlake Nissan
Crown Point, Indiana*