



Did You Know?

NAPA ECHLIN FUEL INJECTORS OFFER THE QUALITY AND RELIABILITY ESSENTIAL FOR TODAY'S ADVANCED FUEL DELIVERY SYSTEMS

GM Vehicle MIL On/Drivability Issues

Drivability Symptoms

- Hard start
- Rough idle
- Misfire

Cause of Failure

- Lack of preventive maintenance
- Clogged injector

USE THE NAPA ECHLIN 2-38765 FOR THESE VEHICLES with 3.1L and 3.4L Engines

2000-2004 Buick Century, Le Sabre, Park Avenue, Regal
2002-2004 Buick Rendezvous
2001-2004 Pontiac Aztek
2002-2004 Pontiac Montana

Contact your local NAPA for other GM vehicles affected.



NAPA Echlin 2-38765

OE

NAPA Echlin Solution

- Replace fuel injector with NAPA Echlin 2-38765 and use dielectric grease on both of the female terminal cavities
- Regular use of NAPA Echlin Pro Clean™ fuel injection cleaning service

TECH TIP:

When replacing the fuel injector O-ring, be sure to install the brown O-ring in the lower position. The fuel injector lower O-ring uses a nylon collar called the O-ring backup, to properly position the O-ring on the fuel injector. Be sure to install the O-ring backup, or the sealing O-ring may move on the fuel injector when installing the fuel rail. If the sealing O-ring is not seated properly, a vacuum leak is possible and drivability complaints may occur.

Whenever a portion of the fuel system has been removed you must check for fuel leaks. To do this, turn the ignition on for 2 seconds, off for 10 seconds, then back on again. Now check all connections for leaks.



NAPA Echlin Fuel Injectors

LOOKS RIGHT. FITS RIGHT. PERFORMS RIGHT.

THE BEAR IS BACK

