



ECHLIN®

DID YOU KNOW?

DIESEL

Diesel Nitrogen Oxide (NOx) Sensors

The Most Comprehensive NOx sensor Program in The Aftermarket

18 SKUs

Covering more than 5 million repair opportunities



Growing line of NOx sensors



Required for emissions regulation



A High-Failure Part That's Required for Emissions Regulations

- NOx sensors monitor the level of nitrogen oxide being emitted by a diesel vehicle to ensure compliance with emissions regulations
- Common causes of failure include soot buildup on the sensor, ECU water intrusion, and/or damage to the cable, which will cause the check engine light to illuminate



DNX3011 - Upstream

Ram Trucks w/
6 Cyl. 6.7L Engines (2018-13)



DNX3012 - SCR Catalyst Outlet

Ram Trucks w/
6 Cyl. 6.7L Engines (2017-14)



DNX3013 - Turbo Outlet Pipe

Ram Trucks (2018-13)
VIO Over 224,000



DNX3014 - Upstream

Ram Trucks (2017-14)
VIO Over 131,000



AFTERMARKET EXCLUSIVE

DNX4016 - Upstream

Mercedes-Benz Trucks (2016-13)
VIO Over 65,000



AFTERMARKET EXCLUSIVE

DNX4017 - Downstream

Mercedes-Benz Trucks (2018-13)
VIO Over 278,000



ECHLIN®

DIESEL

GENUINE DIESEL PARTS

NAPAEchlin.com



ECHLIN®

DID YOU KNOW?


DIESEL



About NOx Sensors

Below is a diagram of a generic Selective Catalytic Reduction (SCR) system used on light-duty diesel passenger trucks. The assembly uses two NOx sensors:

NOx sensor 1
measures
engine out NOx

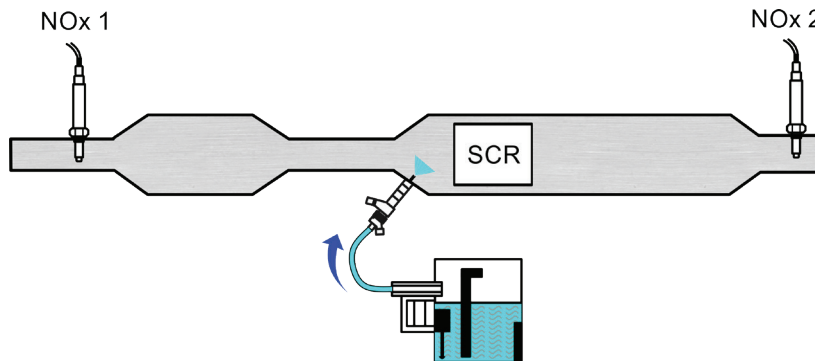

NOx sensor 2
measures NOx
levels exiting the
SCR catalyst

The SCR assembly contains a catalyst brick that requires DEF, or diesel exhaust fluid, for activation. A PCM controlled pump and doser valve are used to meter DEF into the exhaust system upstream of the SCR brick. With the exhaust heat, the DEF will decompose into ammonia and carbon dioxide.

If too much DEF is injected into the exhaust, the SCR brick can become saturated with ammonia and some of it will exit the SCR assembly. This is called “ammonia slip”. Ammonia and NOx look the same to a NOx sensor. Ammonia slip will cause the downstream NOx sensor to report an incorrect amount of NOx in the exhaust stream.

Is the NOx sensor is reporting NOx levels correctly?

While addressing SCR codes concerning DEF quality, NOx sensor failure, or SCR efficiency, it may be necessary to “burn out” saturated SCR bricks and run the onboard diagnostic again. This can be accomplished by performing a manual DPF regen. The heat produced during the manual regen will remove ammonia from the SCR bricks and allow for a more accurate onboard SCR system diagnostic.



NOx Sensor Repair Tips

- A degraded doser valve (DEF injector) may set NOx DTCs
- Be sure to test the doser valve before replacing NOx sensors
- After replacing a NOx sensor, be sure to check service information for any reset procedures
- NOx sensors can't tell the difference between NOx and ammonia
- Performing a DPF regen will release ammonia from the SCR catalyst



ECHLIN®

DIESEL

GENUINE DIESEL PARTS

NAPAEchlin.com

NE10235D-NOX-MAR20