



ECHLIN®

Did You Know?

Vortec Fuel Injection Systems

Central Multiport Fuel Injectors "Spider" Injectors

2-18634 1 per car


New Fuel Injector for C.P.I.

Chevrolet Truck	1992-1995
GMC Truck	1992-1995
Oldsmobile	1992-1995



It is vital that system fuel pressure be checked prior to replacement. These fuel injectors require a minimum fuel pressure of 54-61 psi. See Tech Tips below.

Central Sequential Multiport Fuel Injection

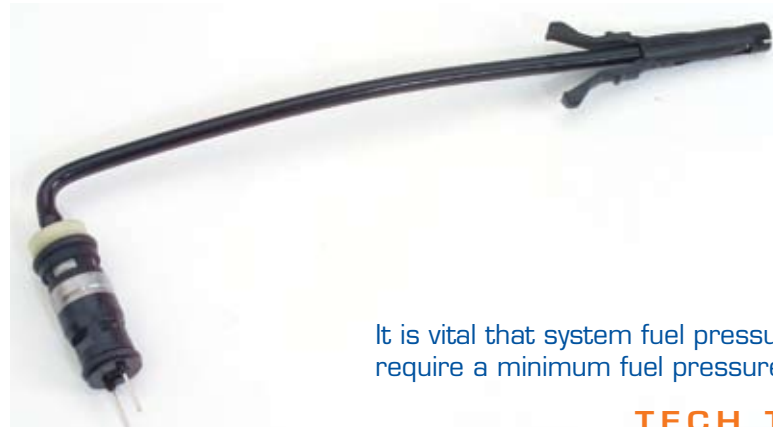

2-18287 6 or 8 per car

Cadillac	1999-2000
Chevrolet Truck	1996-2003
GMC Truck	1996-2003
Isuzu	1997
Oldsmobile	1996-2000

It is vital that system fuel pressure be checked prior to replacement. These fuel injectors require a minimum fuel pressure of 61-66 psi. See Tech Tips below.

TECH TIPS:

These systems are particularly prone to leaks, clogging, and fuel pressure problems. Improper fuel testing procedures is the leading cause of misdiagnosis of these fuel injection systems.

Suggested fuel testing procedures for Vortec fuel injection systems

1. Connect fuel pressure gauge
2. Disable ignition system
3. Hold throttle full open
4. Turn key to on position
5. Pressure should rise above minimum specifications and hold
6. Without turning key off, bleed system pressure to zero
7. Key still on, ignition system disabled, and throttle full open, crank the engine
8. If the pressure rises slowly, suspect a weak fuel pump.

If fuel pressure meets O.E. specifications, the technician should also compare the fuel volume delivered to the fuel injectors against O. E. specifications.

NAPA Echlin Fuel Injectors

LOOKS RIGHT. FITS RIGHT. PERFORMS RIGHT.

THE BEAR IS BACK



EC002-05